

GRAVELY *Technical* BULLETIN




BULLETIN NO. 1030
DATE: September 6, 1963
TO: ALL OUTLETS
SUBJECT: 1. Leaf-Away Modification
2. Pump Cup Wear on 20-Gallon Sprayer

1. LEAF-AWAY MODIFICATION

The Leaf-Away has been modified slightly to permit its use on Tractors with the Super or Custom Hoods.

As shown in the photo, a new Handle Bar Support (Part Number 6245) is used. Also, two new U-Bolts (Part Number 6246) are employed.

The modified Leaf-Away, now standard production, can also be used on Tractors with old Hoods.

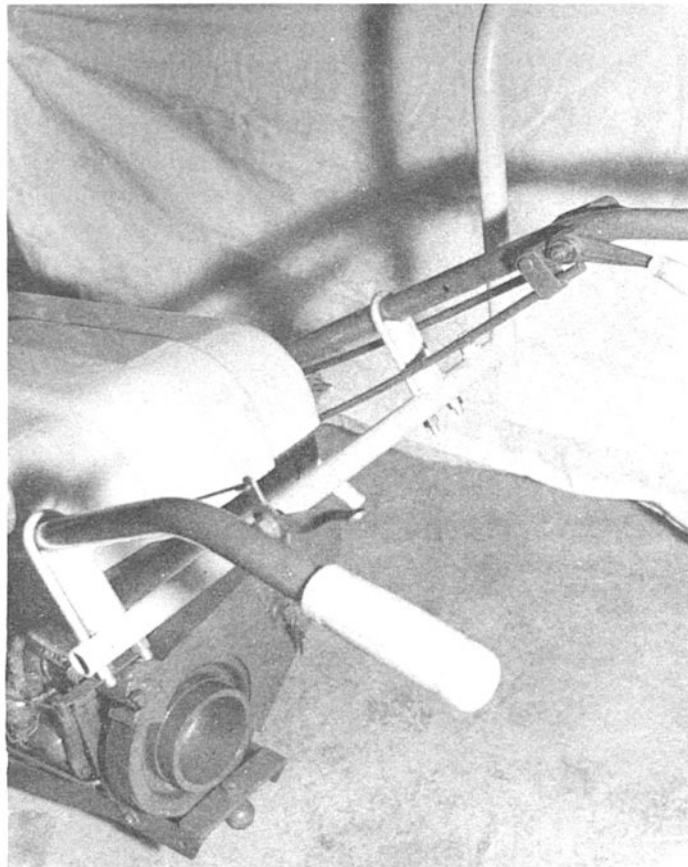

2. PUMP CUP WEAR ON 20-GALLON SPRAYER

Field reports indicate an occasional problem arising from excessive wear of the Pump Cups on the 20-Gallon Sprayer.

This wear is caused by oversize Pistons inadvertently manufactured by our supplier.

When worn Pump Cups are replaced, the proper Piston should be inserted in the Pump. Otherwise, Pump Cup wear will continue.

Difference between the two Pistons can be determined only by use of a micrometer. The oversized Piston is 1.327/1.323-inch; the proper Piston is 1.305/1.301-inch.

##